

Manhole Inspection Summary

Manhole # S33EE_032MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **33EE** Node: **032** Status: **Found**

Insp Date: **2/22/07 12:39 PM**

Incomplete Comments

Crew: **IB, FW**
Inspector: **Bailey, I**
Firm: **PER**

Location Address: **1203 MARTIN LUTHER KING JR BLVD** Cross Street: **BIDDLE ST**

Manhole Type: **Terminal** Location: **Alley** Ground Conditions: **Wet**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **6** (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **42** (in.) Length: (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**


Bench ☐ Exists Material: ☐ Parged ☐ Debris (not Condition related)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **3** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View

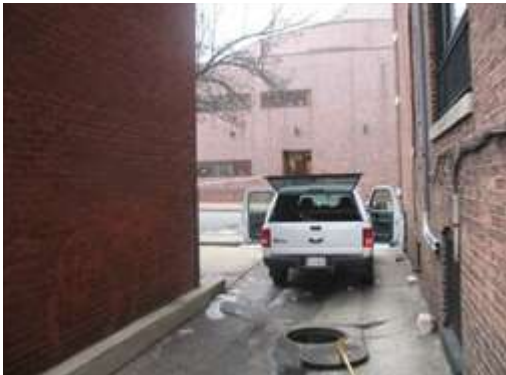

Top View



Corbel and Barrel infiltration. Channel debris.

Defect



Frame leaks. Frame offset. Adjustment deterioration and infiltration. Corbel infiltration - other side.

Defect



Frame leaks. Frame offset. Adjustment deterioration and infiltration. Corbel infiltration.

Manhole Inspection Summary

Manhole # S33EE_032MH

Printed On: 12/17/2008

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.33** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☒ **Grease**

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection